


**Form 0366** - Programming Instructions for Amadas part # 16395 for Different Machine Applications  
**16395 replaces 16942 and 15515**  
**If being used on a Peanut Combine use Amadas Part # 16441**

**IMPORTANT!**

If Amadas part # 16395 is used on a peanut combine the update time will be as much as 30 seconds. We highly recommend using part # 16441 instead which will have a 2 - 3 second update time.

In order for the display to show the correct values, the DT8 Red Lion Rate Meter (Amadas part number: 16395) must be programmed before installation. Below are the DIP Switch settings for your application.

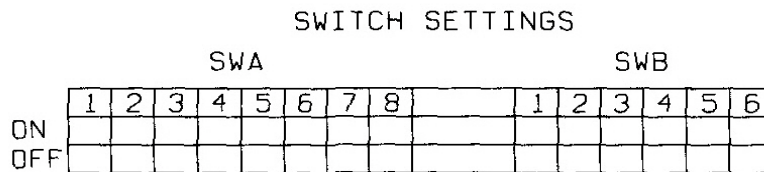

Machine	"ON" DIP Switches	
	SWA	SWB
<b>For Peanut combine applications use part #16441 if possible.</b>		
8557 2-Row Peanut Combines; <1990 (up to Serial #280000)	4,5,6	1,2,3
4&6 Row Pull-Type Peanut Combines; 1990&1993 machines (Serial #280000-310000) [S16942]	4,5,6	1,2,3
4&6 Row Pull-Type Peanut Combines; 1994 to 2004 machines (Serial #320000-429999) [S16942-1]	1	1,2,3,4
4&6 Row Pull-Type Peanut Combines; (Serial #430000-Present)	6,7,8	2,3,4
2002 Model ADI-2 Digger/Inverters (Serial #400000) [70640]	2,5,7,8	
ADI-4&6 Digger/Inverters; 2002 to 2003; (Serial #400000 - with pick-up on conveyor shaft) [70600 - 4-ROW; 70631 - 6-ROW]	2,3,5,7,8	1
ADI-430,-436,-438,-630,-636,-638,-640 Digger/Inverters; (Serial #400000 - Present with pick-up at motor) <b>(displayed as MPH)</b> [S15465-1]		1
ADI-430,-436,-438,-630,-636,-638,-640 Digger/Inverters; (Serial #400000 - Present with pick-up at motor) <b>(displayed as KM/H)</b> [S15465-1M]	2,4,5,8	1
1400,2000&3000 Irrigators w/Turbine Drive;1993-1999 (Serial #310000-370000)	1,2,3,5	
1400,2000&3000 Irrigators w/Hydrostatic Drive; 1993-1999 (Serial #310000-370000)	2,3,7	
1030 Irrigators; 1998-Present (Serial #360000-Present)	8	
1400,2000&3000 Irrigators; All Drives (Serial #380000-Present)	4,7	
C1325/1375 Irrigators; (Serial #430000-Present)	7	